

# Land Rover Range Rover IV - airbag indicator lamp on

Data sheet	
Manufacturer	Land Rover
Vehicle model	Range Rover IV (LG)
VIN	LG000001 – LG118277
Year of construction	2013 - 2014
Symptoms	Airbag indicator lamp lights up. Various error codes relating to the airbags can be set.

Important safety note

# Land Rover Range Rover IV airbag indicator lamp is on and fault or error codes relating to the airbags can be set.

If the above-mentioned problem is detected, one possible cause may be <shy /> a faulty or loosened plug connection for the side airbag.

So as to exclude other causes of malfunctioning, check the periphery in the area of the airbag system.

In such a case, constant contact between the plug connection of the side airbag (<span class="gallery-mode--link" data-order="1">Picture 1 position 3</span>) and upholstery of the seat backrest (<span class="gallery-mode--link" data-order="1">Picture 1 position 1</span>) is responsible for the above-mentioned problem.

#### Remedy:


- Dismantle cover of the seat backrest
- <strong>Define the marked area (<span class="gallery-mode--link" data-order="1">Figure 1
  position 2</span>) of the seat backrest upholstery</strong>
- <strong>(<span class="gallery-mode--link" data-order="1">Figure 1 position1</span>) and cut it out with a suitable tool (e.g. a cutter knife)</strong>
- <strong>Check plug connection (<span class="gallery-mode--link" data-order="1">Figure 1
  position 3</span>) for correct fit</strong>
- Position the plug connection in the cut-out area
- <strong>(<span class="gallery-mode--link" data-order="2">Figure 2 position 4 and 5</span>)
  and fix, ensuring connection is relieved of strain
- Fit cover on seat backrest
- Unlock the airbag system

This should be followed by an error code query using a suitable diagnostic unit (delete error memory if necessary) and a test drive to check the repair measures should also be carried out.


### Note on hybrid vehicles!

## Warning

Please note that such repair work should only be carried out by an<shy /> authorised specialist workshop and that the vehicle manufacturer's repair and maintenance instructions are to be observed!

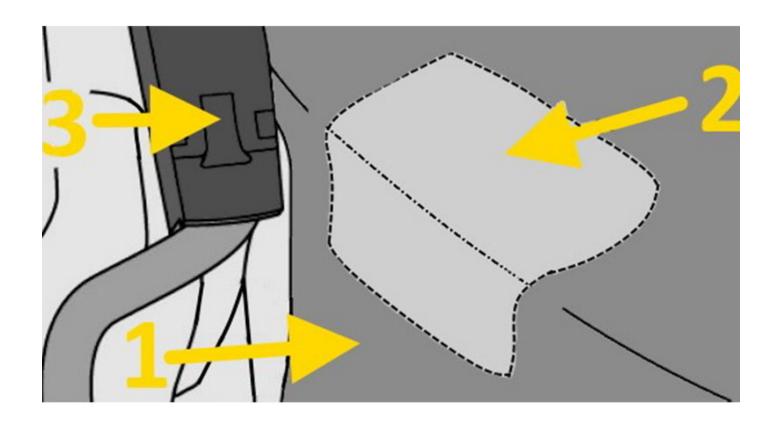

Picture 1: Permanent contact between the plug connection of the side airbag and the seat backrest upholstery

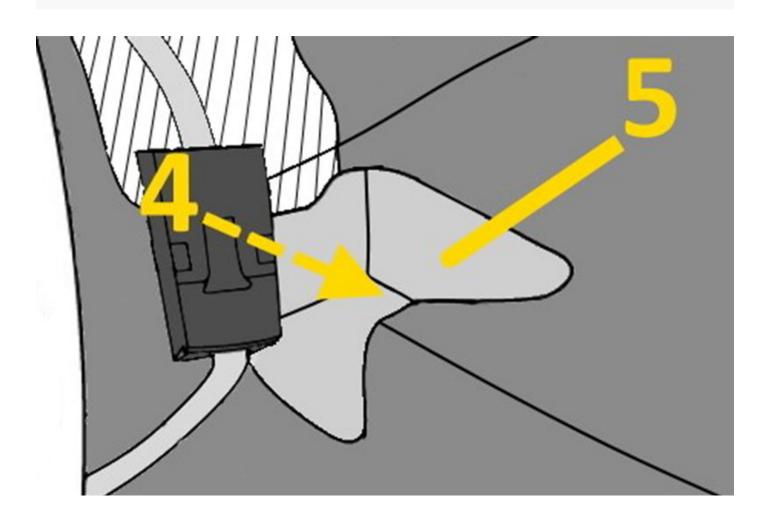

#### Picture 2: cut-out area in the seat backrest upholstery

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.