



# VW Golf 7 - failure of the interior blower

Data sheet

Manufacturer

Volkswagen

Vehicle model

Golf 7

Year of manufacture

2012 - 2017

Symptoms

Interior blower failure

## Important safety note

## Interior blower fan defective in VW Golf 7

In the above-mentioned vehicle with air conditioning and automatic temperature control, sporadic or complete failure of the interior blower fan can occur.

In order to remedy the problem, the error memory of the air-conditioning/heating control unit should be read out. If the error code refers to a mechanical error (e.g. B10BE07), a defect of the blower motor could well be the cause. If the error code refers to the power supply or the signals (e.g. B10BE31), then in most cases the electronic blower controller is defective.

Before replacing components, other causes of malfunction (defective fuse) should be ruled out. In addition, it is advisable to check whether a software update is available for the air-conditioning/heating control unit.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.