

# **Citroen C4 - ESP/ABS pilot lamp lights up | HELLA**

**Citroen**

**C4**

**All left-hand drive models**

**Model years to 06/2008**

## **ESP/ABS pilot lamp lights up**

If a customer complains about the above error, this could be caused by the brake pedal position sensor. Various problems may also occur with cruise control, such as:

- Intermittent or complete failure of the vehicle-speed limiter.
- Intermittent or complete failure of cruise control.
- Cruise control switches on by itself.

The stop lights may also fail. In such cases, the old position sensor must be replaced with a modified version. An adapter lead must also be installed. During installation, ensure that no areas of the lead will become worn.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.