

# **Fiat Seicento - Irregular engine running | HELLA**

## **Fiat Seicento**

### **All models with 899ccm engine**

### **Poland plant**

### **Irregular engine running**

No entry in the event memory

The front right ground cable connection may be faulty if irregular engine running is identified in the above vehicles and there is no entry in the control unit's event memory. Hardening of the insulation material can lead to the cable breaking in the area of the tubular cable lug.

The ground point is located on the right wheel housing behind the headlight in the driving direction.

The resulting voltage drop has a negative impact on the function of the components of the injection system and therefore causes the control unit to shift the adaptation limit and compensate for the interruptions. In this case, check, repair or replace the cabling.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.