

# Ford Transit - Engine cuts out | HELLA

**Ford**

**Transit 2.0**

**Model year: 2001 – 2005**

**Engine code: D2FA**

**with VP30 injection pump**

## **Engine cuts out**

In the above vehicles, the engine may cut out after briefly stepping on the accelerator pedal or running over a pothole.

What is striking here is that when the error occurs while reading the parameters, the injection volume drops to 0 mg/stroke.

The cause of the above error is an insufficient power supply to the engine control module, which is caused by a faulty fuse.

Fuses can be damaged through mechanical tension in the fuse box.

In this case, a hairline crack in the fuse (15 A) at slot 2.05 may be responsible for the error.

The problem can be remedied by replacing the faulty fuse.