

# Kia Rio - Engine warning light comes on | HELLA

**Kia**

**Rio**

**All models, 2000 - 2004**

Fluctuating engine speed.

Engine warning light comes on.

If a problem is indicated by the engine warning light in the above vehicles the customer also complains about a fluctuating engine speed, a possible cause may be a loose connection at the throttle valve potentiometer.

To remedy this problem, first the connector pins on the throttle valve potentiometer and in the wire harness multi-plug should be visually inspected and cleaned.

Note:

The voltages at the throttle valve potentiometer terminals should be checked as follows:

- Potentiometer at ground terminal: approx. 0V.
- Potentiometer at power supply: approx. 5V
- Potentiometer signal terminal: variable voltage depending on the position of the throttle valve.

If the sensor is faulty, it must be replaced. Vehicle-specific sensors can be found within the Hella program.



The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.