



Opel Astra-J Sports Tourer: display code 16

Data sheet

Manufacturer

Opel

Vehicle model

Astra J

Symptom

Display code 16

Important safety note

Opel Astra-J Sports Tourer: display code 16

Code 16 appears on the display ([Fig.1](#)) with information, see operating instructions. Error code Diagnosegerät_B3881 corresponds to faulty tail light lamp or circuit.

Check light functions and, in this case, replace the stop light bulb. To do this, open the rear interior trim and loosen the two wing nuts ([Fig.2](#)). Then remove the rear lamp from the vehicle body towards the rear.

Replace P21W bulb ([Fig.3](#)). Check plug contacts for corrosion.

If necessary, delete the error message stored in the control unit via the diagnostic device. Reassemble in reverse order.



Fig. 1: Code 16 appears on the display


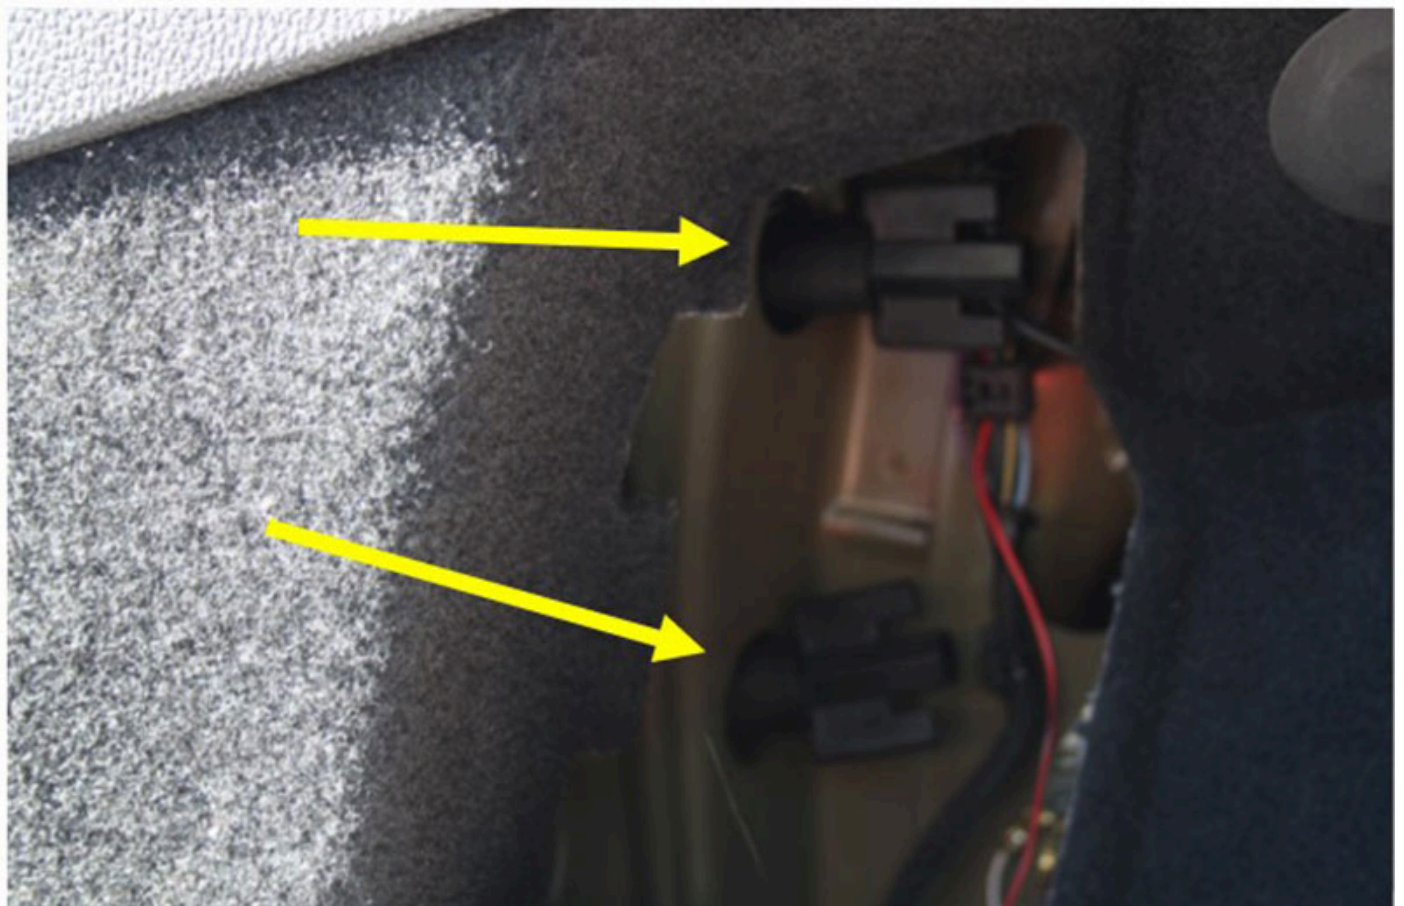



Fig. 2: Internal trim

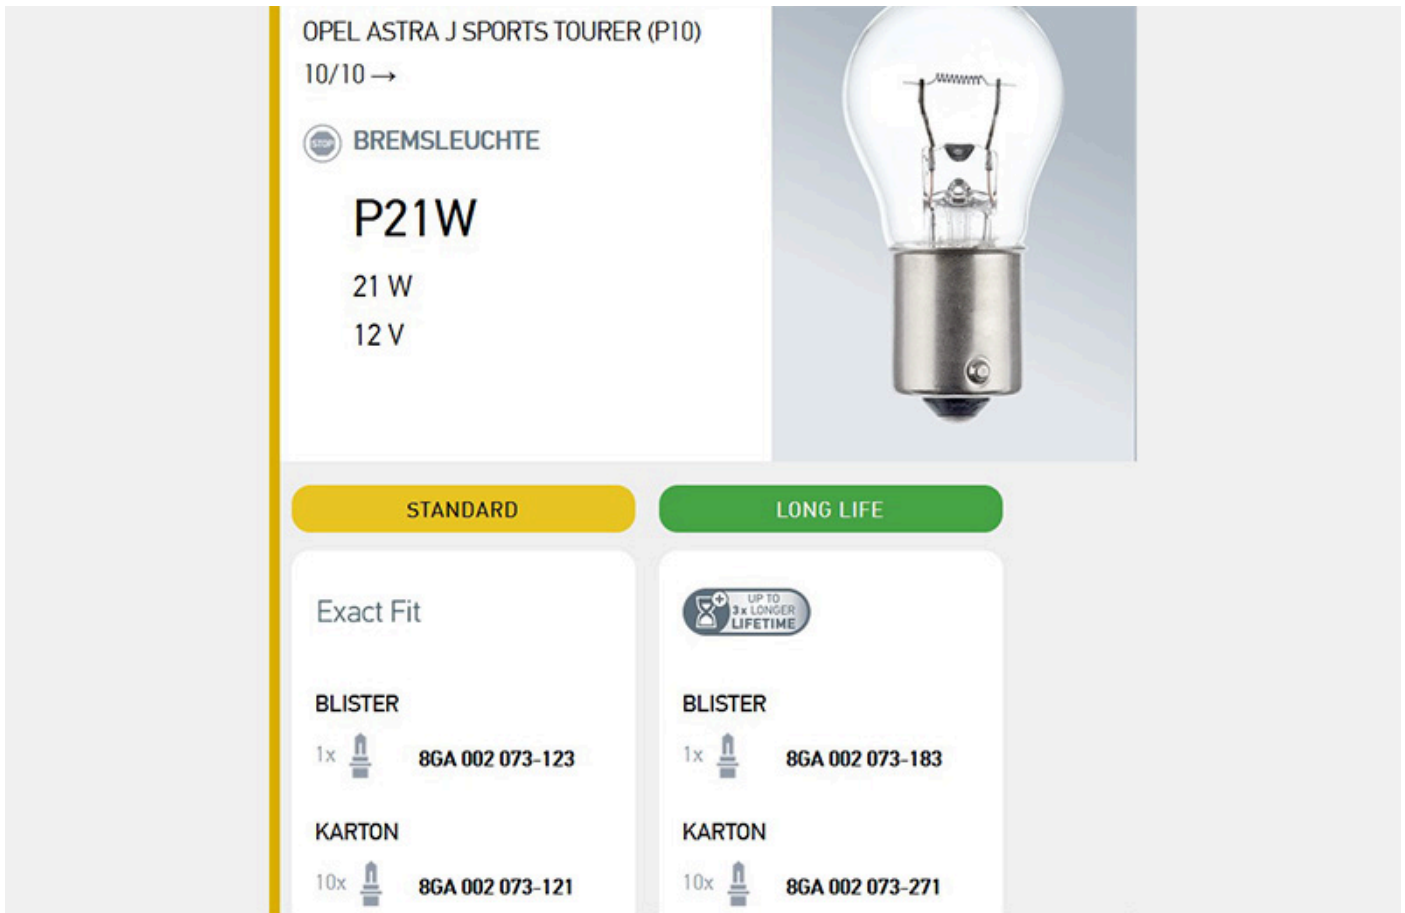


OPEL ASTRA J SPORTS TOURER (P10)
10/10 →

 BREMSLEUCHTE

P21W


21 W
12 V




STANDARD **LONG LIFE**


Exact Fit

BLISTER


1x  **8GA 002 073-123**

KARTON

10x  **8GA 002 073-121**



BLISTER

1x  **8GA 002 073-183**

KARTON


10x  **8GA 002 073-271**

Fig. 3: P21W bulb

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.