

# Peugeot 307 - Left parking light / tail light and licence plate light fail | HELLA

**Peugeot**

**307**

**Year of manufacture: to 13/05/2005**

**3- and 5-door without park pilot**

In the above vehicles, the wiring harness may be damaged in the area between the bumper and the bumper bracket. In addition, the F22 fuse in the fuse box / relay plate of the instrument panel may have blown.

This can cause the parking light, tail light and licence plate light to fail.

An over-long harness of the right licence plate light is a possible cause.

In this case, proceed as follows:

- Expose the licence plate light cables
- Repair the damaged cables.
- Roll up the cable of the right licence plate light to bring it to the same length as the cable of the left licence plate light.