



# Peugeot 308: error code P1385 and jerking during acceleration

Data sheet	
Manufacturer	Peugeot
Vehicle model	308
Engine	1.6 THP-EP6
Year of manufacture	From 2007
Symptom	Error code P1385 - "Ignition misfire detection"   Jerking during acceleration

## Important safety note

## Peugeot 308: jerking during acceleration

If the error mentioned above is detected in these vehicle models, one possible cause may be a poorly attached or defective knock sensor.

In this case, the control unit receives a false "knock signal" and thus changes the ignition timing, which has a negative effect on the acceleration behaviour. If the diagnostics do not reveal a defect in the mixture preparation, ignition system or turbocharger, there is no harm in looking at the knock sensor.

In this case, check the knock sensor and replace where necessary. Then delete the error memory entries.

 **IMPORTANT**

In this regard, please always follow the repair information from the vehicle manufacturer.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.