



## Renault Clio II: vehicle does not start

Data sheet

Manufacturer

Renault

Vehicle model

Clio II

Engine

1.5 L DCI | K9K-712

Year of manufacture

2003-2012

Symptom

Vehicle does not start | Error code 4232 "Rail pressure control"

### Important safety note

## Renault Clio II: vehicle does not start

If the error mentioned above is detected, one possible cause could be a faulty seal on the high-pressure safety valve. Defective seals cause the fuel to be diverted from the high-pressure side into the pump housing and fed into the low-pressure circuit. This means that the fuel pressure required to start the engine – at least 150 bar – cannot be built up.

The safety valve, which is installed in the lower part of the high-pressure pump, must be unscrewed to check the seals. In the event of a repair, both seals must always be replaced. Since the vehicle manufacturer does not offer a spare part, the seals must be obtained from the pump manufacturer or the independent aftermarket.

### IMPORTANT

In this regard, always follow the diagnostic and repair instructions from the relevant vehicle and system manufacturers!

## **This may also be of interest to you**

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.