



# Suzuki SX 4 S-Cross - navigation system malfunction

Data sheet	
Manufacturer	Suzuki
Vehicle model	SX 4 S-Cross
Engine	All models with navigation system
Year of manufacture	From 04/2017
Symptoms	Navigation system malfunction

## Important safety note

## Navigation display malfunctions

The following problem is observed on the vehicles mentioned above. During navigation, the display may malfunction (e.g. delayed image display). A pinched/damaged roof antenna cable was diagnosed as the cause of this malfunction. The cable may get trapped between the antenna base plate and the roof plate during installation. This can lead to interruptions in the cable, causing the malfunctions mentioned above. Please proceed as follows to rectify the problem.

- Remove the roof antenna in accordance with the manufacturer's instructions
- Check the cable for damage and replace the antenna if necessary (OE No. 39253-68L21-000)
- Install the roof antenna in accordance with the manufacturer's instructions, making sure to lay the antenna cable properly.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.