



# Toyota C-HR: noises from the engine compartment

Data sheet	
Manufacturer	Toyota
Vehicle model	C-HR
Engine	1.2i
Engine code	8NR-FTS
Year of manufacture	2016 - 01.01.2018
Symptoms	Noises from the engine compartment

## Important safety note

## Unspecific, rattling noises from engine compartment

The above-mentioned vehicle may make unspecific, rattling noises from the engine compartment.

A possible cause to consider is the boost pressure control valve, which may vibrate because of pressure fluctuations.

In order to remedy this, it is advisable to replace the vacuum line with a modified version (25781-47030) and also to fit a retaining clip (23841-28050).

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.