



# Volkswagen T6 - hissing noise from engine compartment

Data sheet	
Manufacturer	Volkswagen
Vehicle model	Transporter T6 (SF/SG)
Engine	2.0 TDI (CAAC/CXFA/CXHA)
Year of manufacture	2015 - 2019
Symptoms	Hissing noise from the engine compartment

## Important safety note

## Hissing noise when accelerating

On the vehicles mentioned above, hissing noises can occur from the engine compartment during the acceleration phase. There is often no noticeable loss of power and the engine control lamp is also off.

Defective or loose hoses or hose connections in the area of the charge air cooler are possible causes ([Fig. 1](#)).

In addition, it is also possible that the charge air cooler itself is damaged. Often a visual inspection reveals the cause. Traces of oil on the surface ([Fig. 2](#)) indicate a crack, which causes the noises mentioned above.

The charge air cooler must be replaced to rectify the problem.



Figure 1: Charge air cooler



## Figure 2: Oil traces on the charge air cooler

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.