



## VW T6 - engine not running smoothly

### Data sheet

Manufacturer	Volkswagen
Vehicle model	Transporter T6
Engine	2.0 TDI
Year of manufacture	2016 - 2019
Symptoms	Engine not running smoothly

### Important safety note

## Engine not running smoothly: Engine check lamp or preheater check lamp lights up

The engine may not be running smoothly in the above-mentioned vehicles. The engine control lamp and/or the preheater control lamp will light up in this process. Fault code P0191 may be saved in the fault memory.

Check all system-relevant electrical and mechanical components, including the power supply to eliminate the issue.

If no fault is identified, the cause may be the pressure sensor of the fuel rail (figure).

After having replaced the sensor, delete the fault memory and go for a test drive.



Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.