



## Audi A4, A6, A8 and Q7: error code P3134 and engine warning lamp lights up

Data sheet	
Manufacturer	Audi
Model	A4, A6, A8, Q7
Engine	V6 TDI (2.7 L and 3.0 L)
Year of manufacture	2004 - 2010
Symptom	Error code P3134 "Intake manifold flap for airflow bank 1"; engine warning lamp lights up.


### Important safety note

## Error code P3134 "Intake manifold flap for airflow bank 1" on Audi A4, A6, A8 and Q7

This defect usually occurs in vehicles with a high mileage. One possible cause for this is too much play in the shaft bearing or in the ball heads of the intake manifold flap's connecting rod. A defect is easy to detect by doing a visual check with simultaneous manual operation.

The intake manifold flap and actuator form one unit and must be completely replaced in the event of repair.

Repair note: After replacement, the new intake manifold flap must be taught in the control unit using a diagnostic device. The mega macs uses menu item "Basic settings" for this, as shown in the illustration as an example.

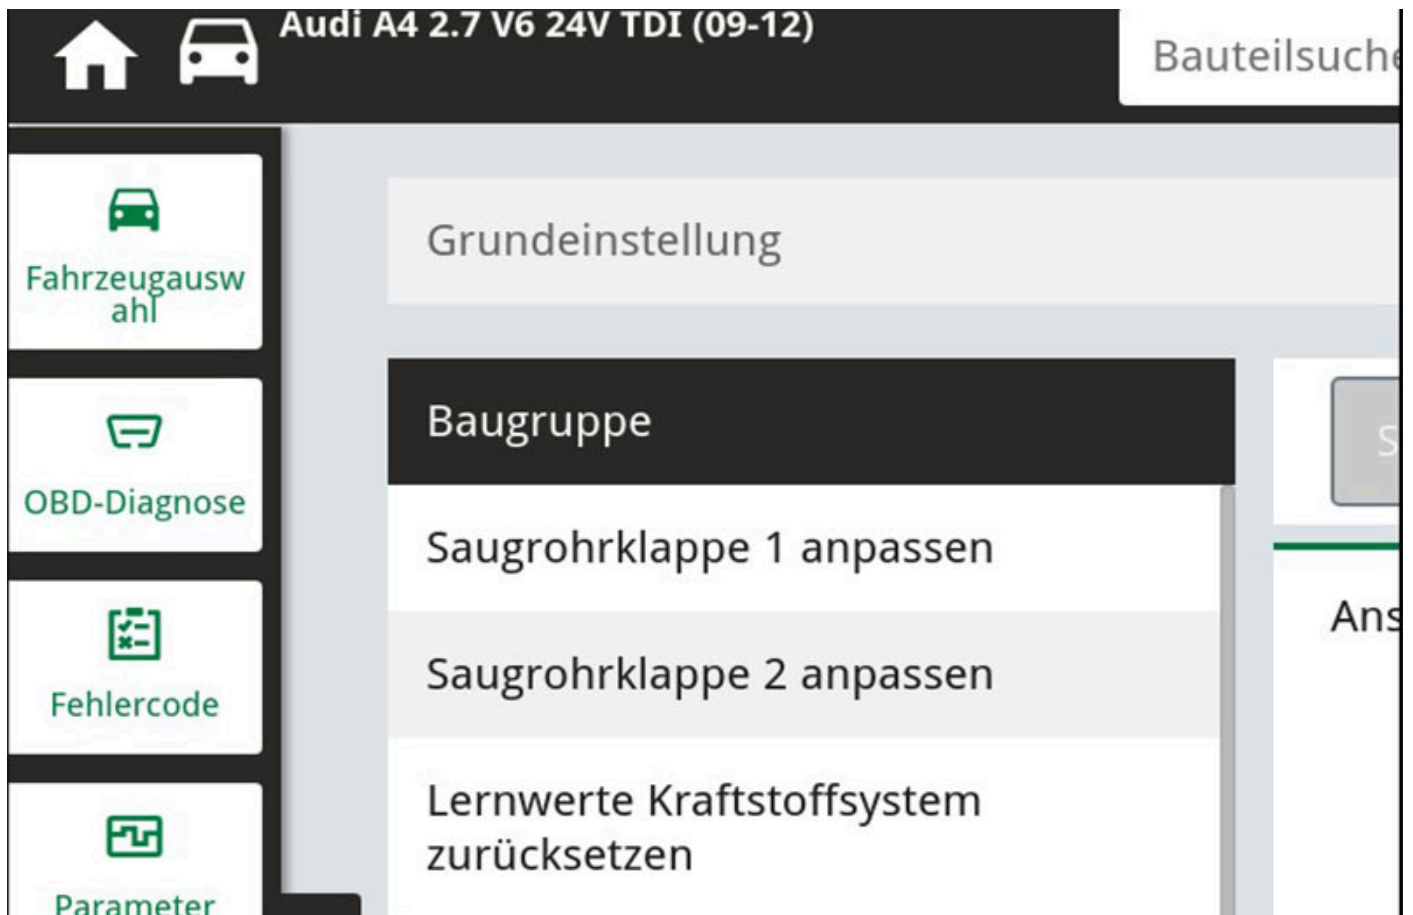

mega macs menu item "Basic settings"

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.