

# Citroen C-Crosser - Stop lamp failure | HELLA

**Citroen**

**C-Crosser**

**Model year: 2007 - 2009**

## **Stop lamp failure**

There have been complaints of a stop lamp failure on the aforementioned vehicles (warning light on instrument cluster lights up).

This problem is caused by a defective stop-lamp switch (soiled silicone on the contacts).

The vehicle manufacturer has already addressed the issue and notified the owners of all the affected models. For various reasons, however, it must be assumed that not all vehicles have been checked or modified.

Specialist garages will replace the defective stop-lamp switch in the affected vehicles with a new one.

To remove the stop-lamp switch, proceed as follows:

- Remove the paneling above the pedal
- Turn the switch one quarter-turn counterclockwise
- Remove the switch
- Detach the connector
- To install the new stop-lamp switch, perform the above procedure in reverse
- Once the new stop-lamp switch has been installed, test it to ensure that it works properly