




Citroen C3 - engine control lamp is on and the radiator fan is permanently on

Data sheet	
Manufacturer	Citroen
Vehicle model	C3
Engine	1.4l petrol engine
Engine code	8FP
Year of manufacture	From 2009
Symptoms	Radiator fan permanently on Engine control lamp on Error codes: P0598, P023B, P0947

Important safety note

Error codes P0598, P023B, P0947 when the radiator fan is permanently on

If the error message "Motor overheated" is displayed on the instrument cluster on the vehicle models mentioned above, one cause for this may be a defective heater for the oil vapour extraction. A defect in the heater will cause fuse F5 to blow. All components designated in the error codes are protected by this fuse, which leads to the corresponding error entries. In this case, the defective heater must be removed and replaced with a new one. Then replace the fuse with a new one and delete the error entries.

 **Please note**

The heater for the oil vapour extraction is usually only required in very cold regions and can be shut down in geographically warmer regions by disconnecting the electrical connector. This measure does not cause any error entries or disturbances.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.