



## Mazda CX5 - error code P0471 and poor starting and acceleration behaviour

Data sheet	
Manufacturer	Mazda
Vehicle model	CX5 GH/KE with automatic transmission
Engine	2.2 16V CDI Skyactiv-D
Engine code	SH-Y4
Year of manufacture	2013-2017
Symptoms	Poor starting and acceleration behaviour Vehicle goes into emergency mode Error code: P0471

### Important safety note

## "SCBS forward gear malfunction" is displayed on the instrument cluster

If the error message "SCBS / City emergency stop assistant forward gear malfunction" is displayed on the instrument cluster on the vehicle models mentioned above, one cause for this may be a defective boost pressure sensor. The faulty signal can cause error entries in different control units. In addition, the warning lamps for tyre pressure control, parking brake, I-Stop system and ABS may light up simultaneously. The error can be reset briefly by switching the ignition off and on, but usually reappears after a short driving time.

Control unit diagnostics The following error codes may be stored in various system control units for this cause.

Comfort control unit

- CAN connection for distance control system – signal implausible  
ABS control unit

- U0401 CAN-BUS – Invalid data  
Engine control unit


- P0471 Exhaust pressure sensor 1 (boost pressure sensor) – function faulty  
<shy /> Repair advice<shy /> Continuing to drive with this defect can damage the engine. In addition, the deficiency causes hard shifting behaviour in vehicles with automatic transmission.<shy /> The vehicle manufacturer replaced the exhaust pressure sensor with a new modified component.<shy /> Within the scope of the repair, it must therefore be ensured that the old defective sensor is replaced by a new modified sensor (repair kit).<shy /> After the repair, the relevant error memory entries in the relevant control units must be deleted.<shy />

Spare parts information<shy /> Exhaust gas pressure sensor old: Mazda SH02-BK-5204<shy />  
Exhaust pressure sensor new: Mazda SHY6-18-W00

**ⓘ Please note**

This defect may also occur in other vehicle models with the same type of engine and transmission equipment.

**SCBS  
Vorwärtsgang  
Fehlfunktion**

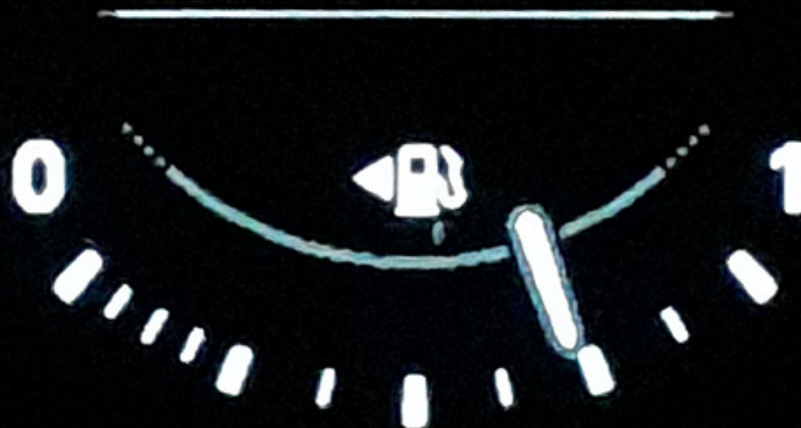

## Warning on the instrument cluster

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.