



# Mercedes E-Class W211 - noise from the front suspension area

Data sheet

Manufacturer

Mercedes

Vehicle model

E-Class W211

Year of manufacture

2002 - 2010

Symptoms

Noise generation on uneven road surfaces

## Important safety note

## Noise generation on uneven road surfaces

On the vehicles mentioned above, unspecific, squeaking or creaking noises can occur from the area of the front wheel suspension. These are particularly noticeable when driving on uneven road surfaces. Excessive friction between the shock absorber piston rod and the bump stop is a possible cause. This can be remedied as follows:

- Lift the shock absorber's dust boot so that the piston rod is visible
- Apply lubricant (A001989845110) to the piston rod
- Return the dust boot to its original position
- Carry out a test drive

## Please note



Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.