

Nissan Qashqai (J10) - warning lamp for ABS / ESP

Data sheet	
Manufacturer	Nissan
Vehicle model	Qashqai (J10)
Engine	1.5 DCI
Engine code	К9К
Year of manufacture	2007 - 2014
Symptoms	ABS / ESP warning lamp is activated while vehicle is being driven

() Important safety note

ABS/ESC warning lamp activates while vehicle is being driven and error code C1130 is stored

The ABS/ESP warning lamp may light up sporadically on the above-mentioned vehicle series. After a restart, the warning lamp initially goes out again, but is reactivated after a short driving time.

Error code C1130 "Engine control unit - signal faulty" is stored in the error memory of the ABS/ ESP control unit.

When this happens, there can sometimes also be a loss of performance.

In such a case, a connecting pipe clogged with exhaust residue may be the cause. The result is that the engine control unit sends the ABS/ESP control unit an incorrect torque signal and the warning lamp is activated.

The connecting pipe, which runs from the exhaust pressure sensor to the exhaust manifold, should be dismantled in accordance with the manufacturer's instructions and checked for excessive deposits caused by exhaust residues. The banjo bolt for fastening the connecting pipe to the exhaust manifold must also be checked for exhaust residue.


If the above-mentioned defect is detected, cleaning the connecting pipe and replacing the banjo bolt can remedy the situation.

Once the cause of the fault has been removed, delete the error memory and then carry out a test drive.

(

IMPORTANT

Please always follow the repair instructions from the vehicle manufacturer when carrying out such work.

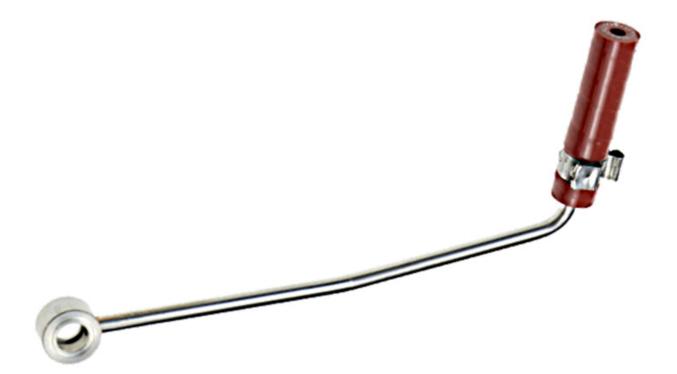

This may also be of interest to you

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.