

# Opel Astra J - control lamp flashes | HELLA

Opel

Astra J

Model year: 2010–2012

Engine: A14XEL / A14XER

## “Coolant temperature” control lamp flashes

The coolant temperature warning light may suddenly flash on the vehicles listed above. Code P00B7 (engine coolant flow insufficient) is stored in the error memory.

The cause may be an insufficient delivery rate of the coolant pump (in certain operating situations).

To remedy the fault, a modified coolant pump (55579016) should be installed.