



Opel Corsa E - straight-line driving impaired: Vehicle pulls to one side

| | |
|---------------------|---------------------------|
| Data sheet | |
| Manufacturer | Opel |
| Vehicle model | Corsa E |
| Engine | All models |
| Year of manufacture | 2014 - 2019 |
| Symptoms | Vehicle pulls to one side |

Important safety note


Vehicle pulls to one side

On the vehicles mentioned above, the vehicle may pull to one side even though the steering wheel is in the straight-ahead position.

Often the following measures have already been performed, which make sense but have not led to success:

- Tyre pressure checked
- Axle parts/axle suspension checked (joint/bearing play; spring broken, shock absorber defective etc.)
- Wheels exchanged
- Wheel alignment carried out
- Error memory read out (no error stored)

To remedy this, the steering angle sensor can be recalibrated using a diagnostic device. Experience shows that the vehicle then runs straight again.

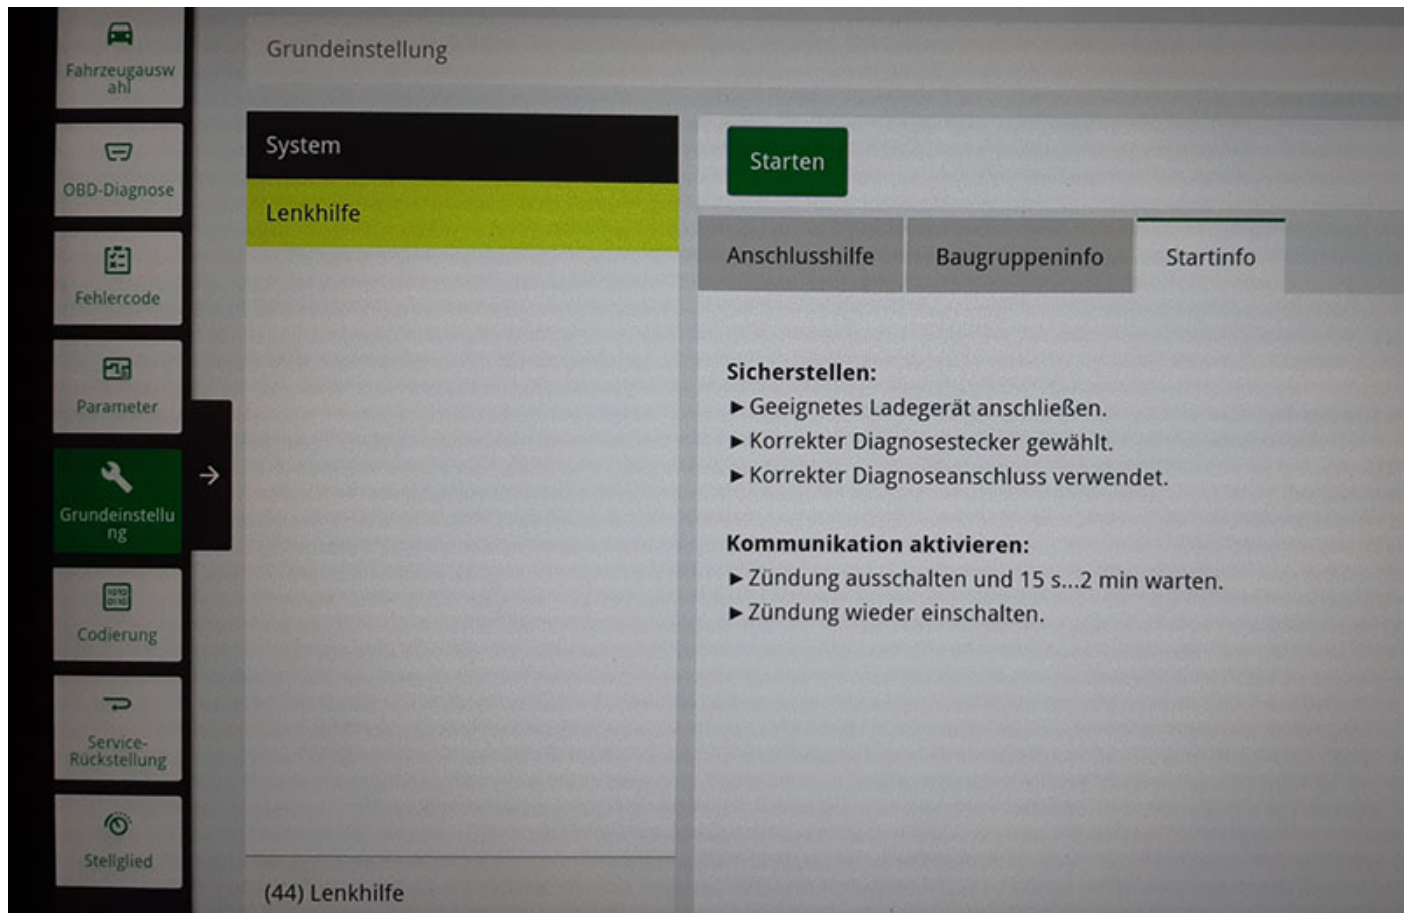

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.