

# Opel&nbsp;Omega B - Failure of the rain light sensor | HELLA

Opel

Omega B

**All models: 05/2000 to 05/2002**

## **Failure of the rain light sensor**

If a malfunction/failure of the automatic windshield wiper function is complained at in these vehicles, a possible source of fault is the two rain sensor relays. They should be checked and replaced if necessary. The two relays are located in the fuse box (engine compartment).

Starting from VIN W0L0VBF6921061034, revised or optimised rain sensor relays (2 pieces) have been used.

- Spare part no. 93175483

- Catalogue no. 62 38 627

Note:

If the error analysis revealed a defect in the rain sensor (control electronics), the two rain sensor relays need to be replaced in this case also (see above).

Additional information about the replacement of the rain light sensor can be found in the TI - Technical information - database

- Replacing the rain light sensor with silicone repair kit.