

Renault Clio - Low beam not functioning | HELLA

Renault

Clio 2, 1, 5D dCi

Engine: K9K 704

Model year: 2001 - 2006

Low beam not functioning

Defective relay contact

If the low beam has failed in the above-mentioned vehicles, this may be associated with defective positioning of the low beam relay in the plug base. Since the relay is mounted in the footwell below the glove compartment on the front passenger's side, the defect may have been caused by front passenger "foot contact." In this case, the position, fastening and plug of the relay must be checked and repaired if necessary. We also recommend securing the relay on the relay socket with a cable tie.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.