



# Seat Arona - noise from the front of the vehicle when manoeuvring

Data sheet	
Manufacturer	Seat
Vehicle model	Arona
Engine	All models
Year of manufacture	2017 - 2021
Symptoms	Noises in the front area when manoeuvring

## Important safety note

## Noises in the front area when manoeuvring

The following problem is observed on the vehicles mentioned above.

The noise may occur when manoeuvring the vehicle.

The cause was diagnosed as unwanted friction between the front suspension strut and the shock absorber bump stop.


Please proceed as follows to rectify the problem.

- To access the shock absorber piston rod, lift the protective cover and bump stop upwards.
- Thoroughly clean all contact surfaces and coat them with

silicone grease article no. G 000 405 A2 (only use the specified type of silicone grease), as marked in the image, to the contact surfaces between the shock absorber piston rod and the shock absorber bump stop

- Assemble the dismantled parts in reverse order.
- Repeat the procedure on the other side of the vehicle.

Finally a test drive should be performed to check the repair work.

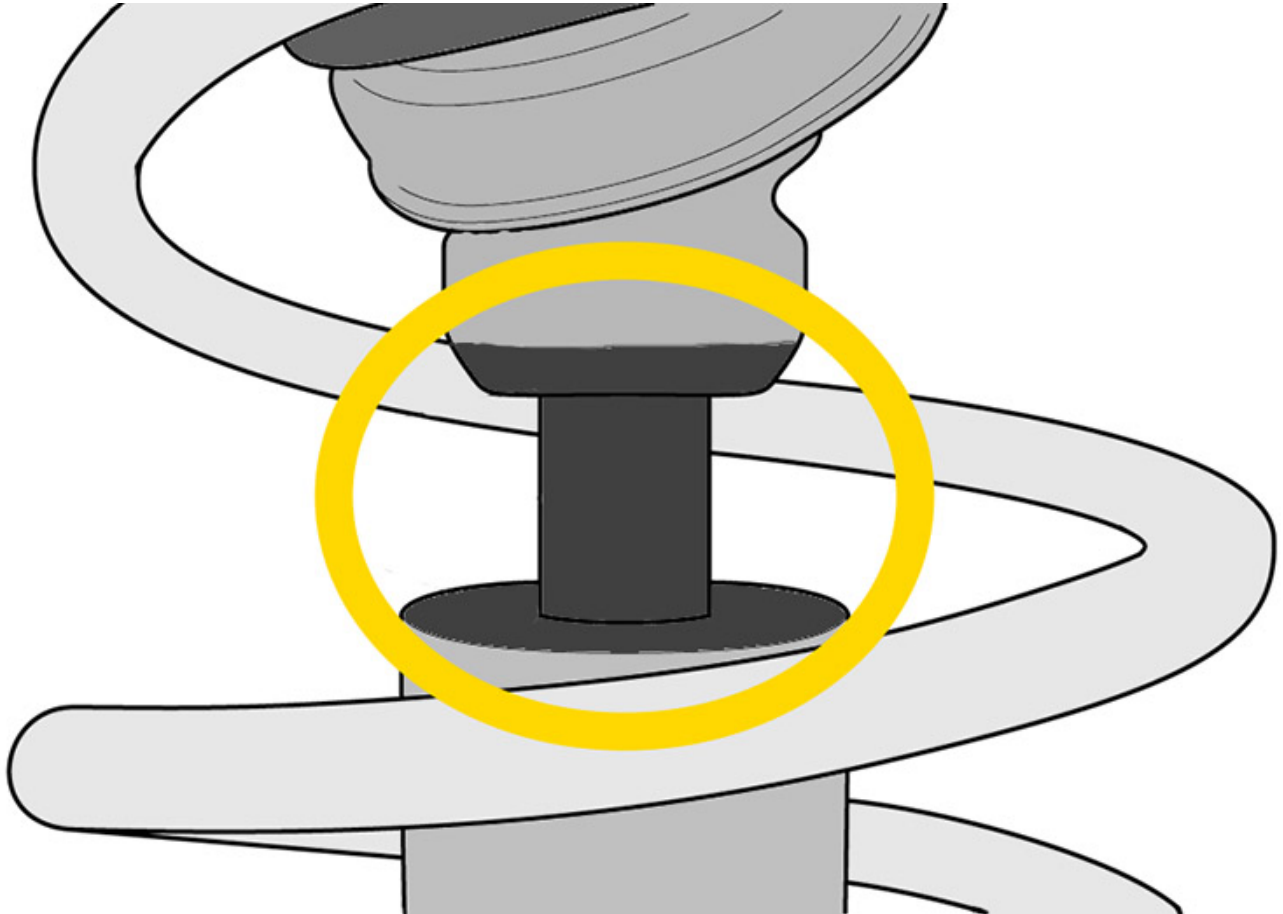

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.