



Audi A6, all models model years 1997 – 2004

Engine doesn't start

If this fault is complained about, then a damaged wire harness of the immobilizer may be the cause. Also the error "Signal from receiver coil or key too weak" may be stored. The wire harness may have been installed in such a way that the steering column casing damages individual cables of the wire harness.

In that case, proceed as follows:

- Dismantle steering column casing.
- Check wire harness for damage (see Fig.), broken cables etc. and repair if need be.
- After repair, install the wire harness in such a way that damage is ruled out.

