



BMW E 36 ***All Compact and Touring models***

False specification on the label in the fuse-box.

With these vehicles it is possible that a false value has been given on the label in the fuse-box for fuse no. 3 (headlamp cleaning system, rear wiper). A 30 A fuse is necessary here, whereas the label states only a 15 A fuse. If a 15 A fuse has been installed, this works at its limit when all the electrical loads are switched on, and could blow.

In the case of repair, a 30 A fuse must be used and the specification for fuse no. 3 on the label in the fuse box corrected using a waterproof pen.

Bulletin

