



BMW E 36 with M 52 engine built until 06/1997

Ticking noises in the vehicle interior.

If there are complaints with this vehicle that a ticking noise can be heard in the interior, one possible cause is the tank ventilation valve. The valve is installed on the dome of the suspension strut on the front left-hand side. The ticking noise generated by structure-borne noise transmission when the valve is working is what can be heard inside the vehicle.

To eliminate the noise, the installation position of the tank ventilation valve must be changed from the dome of the suspension strut to the induction pipe. The valve is installed on the induction pipe using a conversion kit.