



BMW E 38 (7 Series) With engine M60, M62, M73

Oil pressure warning light illuminates.

If there are complaints with these vehicles that the oil pressure warning light illuminates even though the engine oil level and oil pressure are in order, one possible cause is a corroded plug connection on the oil pressure switch. Water can penetrate through a faulty wiring harness connector on the oil pressure switch and lead to corrosion of the plug-in contacts. In the event of complaints, the oil pressure switch and wiring harness connector must be replaced.

Bulletin

