



## *BMW E 39 up to 12/95 Flickering headlight*

In headlight levelling position 2, light /dark border changes permanently

With a loaded vehicle and the headlight leveling switch in position 2 (max) it is possible that the servomotors are constantly moving. This is caused by an incorrectly fixed potentiometer on the circuit board of the levelling control unit, this in turn causes a voltage change leading to the servomotors repositioning.

In this case the headlight levelling switch must be replaced. From beginning of December 95, this fault has been eliminated through an improved headlight levelling switch and control.



# Bulletin

