



BMW

E36 with engine M51 (325tds)

E38 with engine M51 (725tds)

E39 with engine M51 (525tds)

from model year 01.1996

Engine has no power following overrun.

If there are complaints with these vehicles about the engine losing power after overrun and engine speeds below 2000 rpm one possible cause is a loose vacuum hose.

The vacuum hose concerned is the one leading from the pressure transducer to the exhaust gas recirculation valve. In this case the vacuum hose is not fully pushed onto the exhaust gas recirculation valve. To eliminate the fault the vacuum hose has to be pushed onto the valve again and suitable action must be taken to prevent it slipping down again.