



## **BMW**

### **All models with tilt/slide sunroof**

### **Model year 1994 - 2004**

#### **Failure of the "tilt function" of the tilt/slide sunroof.**

If there are complaints with these vehicles that the touch function of the tilt/slide sunroof is no longer working, one possible cause is an interruption to the voltage supply, e.g. after the battery has been disconnected and reconnected. To eliminate the fault the touch function has to be reprogrammed. To do this proceed as follows:

- Switch on the ignition
- Move the tilt/slide sunroof switch in the direction of "Tilt or lift" and keep it in place.
- When the final switch position has been reached, keep it pressed for a further 20 seconds.
- If programming has been successful, this is confirmed by the tilt/slide sunroof being lifted slightly.