



Citroën XM (Y4)

Stop light not working/ stop light switch faulty

In the case of the above-mentioned vehicles without ABS, a faulty stop light switch can lead to failure of the stop lamps. The stop light switch (photo) is located in a plastic housing mounted on the brake pedal. The upper part (on the seat of the pedal rubber) is spring-loaded, and operates the switch via a small plastic pin. Since the switch switches the entire current of the stop lamps, the plastic pin can char due to excess load (in particular in the case of vehicles with a trailer). This shortens the pin, and the switching function is no longer guaranteed. In this case the switch must be renewed.

