



Citroen Xsara Picasso With 2.0l HDI diesel engine

Loss of power and black smoke.

If there are complaints with these vehicles that the engine performs poorly and black smoke develops, one possible cause could be a loose hose connection. In this case, the connection between the turbocharger and the air line is affected. The connection is made by a rubber sleeve. This rubber sleeve becomes loose at the turbocharger output, which leads to too little air in the carburetion.

To eliminate the problem a new, longer rubber sleeve has to be installed. At the same time, the stop for the rubber sleeve on the air line must be removed to ensure that the sleeve can be pushed far enough onto the air line. In addition to the new sleeve, the mounting clips should also be renewed.