



Fiat Stilo with petrol engine

Noise from valve of activated carbon canister

With the above-mentioned vehicles, noise can sometimes be heard coming from the rear right-hand side of the vehicle when on bumpy roads. The noise is usually caused by a metal ball inside the multi-function valve of the activated carbon canister. The only way to solve the problem is to replace the complete activated carbon canister including the integrated multi-function valve. If a replacement has already taken place, there will be a white spot of paint on the head of the lower attachment screw of the fuel tank flap.

The activated carbon canister (see illustration, item c) is at the rear right-hand side of the wheel housing. For dismantling, the hoses (see illustration, items marked "a") and the attachment nuts (see illustration, items marked "b") have to be removed.

