



Ford Escort 01/95 up to 06/98 (Code SC up to WU). Rear window heating, rear wiper and boot illumination inoperative.

Temporary or permanent interrupted function of the above listed components.

If these fault symptoms are stated by the customer, the cause can be the contact plate and the contact switch. This is due to incorrect orientation of the contacts to each other. In this case the mounting hole of the plate and the switch must be moved.

1. Disconnect the battery.
2. Dismantle the contact switch from the boot.
3. Unscrew the contact plate from the rear wall panel.

Attention:

The holes may not be moved more than 2 mm, otherwise the holes will not be covered when the switch is re-mounted.

4. Re-drill the holes of the contact plate, 2 mm towards the vehicle centre.
5. Re-drill the holes of the contact switch 2 mm in the opposite direction.
6. Fasten the plate and switch, seal with bodysealer, in the correct position.
7. Clean and grease the contact faces of the contact plate and contact switch.
8. Attach the battery and check the function of the components.