



Ford Mondeo, Build Year 05.95 – 04.98

Inoperative blower motor in switch position 1, 2 and 3 and/or a smell like melted plastic from the right front foot well.

To rectify the problem:

A bad electrical contact at the blower resistor motor can be the cause and must be renewed.

1. Remove the blower motor and blower motor resistor under the dashboard in the right hand foot well
2. Remove the blower motor switch behind the middle of the dashboard
3. Renew the wiring, with a changed plug, from the switch to the resistance
4. Refit components in reverse order
5. Check the function

Best Regards

Your Service Partner Technical Team

Bulletin

