



Ford Mondeo 2001 With 2.0 TDDi and TDCi Engines

Loss of engine power.

If there are complaints about the above-mentioned fault, a possible cause is a loosened/disconnected or slipped-off hose on the turbocharger – exhaust, or on the air intake line or the exhaust line of the intercooler.

To remedy the fault, the hoses on the turbocharger and the intercooler must be checked to ensure that they are correctly fitted. If a loosened/slipped-off hose is found, the hose and the connection at the turbocharger or the intercooler must be cleaned of residual oil before being refitted.

For safety reasons, check all other hose clips and hoses for correct fit and for correct tightening torque (4 Nm).

Bulletin

