



Ford

Transit

Model year: 2000

Engine: 2.4 litre diesel

Faulty indicator function

Faulty function of the indicators can occur with the above-mentioned vehicles. If the flashing frequency should be outside the specification (60 - 120 times per minute), a faulty or incorrectly programmed flasher relay could be the cause. Before reprogramming or replacement of the flasher relay, the light sources should be checked for signs of defects, loose contacts and correct wattage.

The relay can be reprogrammed as follows:

- Switch off the ignition
- Remove fuse no. 27 (50A) from the fuse box in the engine compartment
- Wait 40 seconds
- Replace the fuse
- Switch on the ignition
- Operate the left indicator and allow it to flash at least 3x
- Operate the right indicator and allow it to flash at least 3x.
- Carry out a function check
- Replace relay if necessary