



Ford Transit, build year up to 04/2000 with 2,4 L diesel engine

Indicator lamps are repeating to fast or have a malfunction.

If a malfunction or a too fast repeating of the indicator lamps is apparent, the cause could be due to the following: A missing, loose, wrong indicator lamp or a faulty programmed indicator relay. To solve the problem consider the following steps:

- Check that the lamps are fitted in the indicator and if they are the correct ones. If 28 watt lamps are fitted, they must be changed with 21 watt lamps.
- Check the lamps for correct fitting.
- Check the indicator. If the function is not okay, the indicator relay must be reprogrammed.

Programming of the indicator relay:

- Remove the fuse № 27 (red, 50A) in the engine bay fuse box.
- Wait at least 30 seconds and refit the fuse.
- Switch on the ignition.
- Switch on the left indicator lamp and let it illuminate 3 times (or more)
- Switch on the right indicator lamp and let it illuminate 3 times (or more).
- Programming complete.
- Recheck functionality