Bulletin



© Hella KGaA Hueck & Co., Lippstadt 14 January 2008 1-1

Ford Transit All models from model year 07.2003 to 10.2005

Oil-pressure control lamp illuminates

If there are complaints about the above-mentioned fault, the cause could be a corroded plug-connection. The above-mentioned fault arises due to water penetration in the plug-connection. In this case, proceed as follows.

- Disconnect the plug-connection and check the contacts for corrosion.
- If the corrosion is only light, clean the contacts. Apply electronics grease to all of the plug-housing and then press the plug-connection together again.
- If the corrosion is already heavy, the plug and, if necessary, also the oil-pressure switch should be replaced. The manufacturer offers a repair kit for this problem.



