



Ford Transit with double rear door, model year 2000

Failure of the heated rear window and/or central locking system.

If there are complaints with this vehicle that the heated rear window and/or the central locking system fail, one possible cause is damage to the wiring harness on the rear door.

To eliminate the problem, a modified wiring harness with a reinforced cable duct must be installed. To do this proceed as follows:

- Remove the panelling on the rear door and remove the sealing foil in the upper area.
- According to equipment level, separate the plugs for heated rear window, the central locking system and the third brake light.
- Remove the rear lamp. The plug connections which must be separated for the rear door wiring harness are behind the rear lamp.
- Remove the rubber gaiter (see illustration) and unclip the cable duct from the door and the D-pillar.
- Pull out the wiring harness.
- Fit the new wiring harness and refit all the components in the reverse order of removal.
- Check all systems to make sure that they are working.

