



Isuzu Trooper ***All vehicles with manual transmission*** ***From model year 1998 to 2003***

Illumination of the engine control lamp

If there are complaints about the above-mentioned fault, the cause could be a defective transmission idle switch. In addition, the fault codes P0301, P0302, P0303 and P0304 (misfires on individual cylinders) may be read out. In this case, the switch should be checked by means of a diagnosis tester. Also, a resistance measurement can be carried out using a multimeter. In the event of an internal interruption, the resistance will go towards infinity.

