



## ***Land Rover Defender 90/110/130 model years 1999 – 2004 with engine 2.5L TD5***

### **Insufficient power**

If this fault is complained about, then an insufficient sealing of the plug (see Fig.) between the engine wire harness and the wire harness for the injection valves may be the reason.

Backfire, engine start failure and lighting of the engine control lamp may also be effects of the fault.

In that case, proceed as follows:

- Detach the plug and check it for soiling.
- If the contacts are soiled by oil etc. then clean them with a suitable cleaner until correct contacting is guaranteed.
- If the contacts are heavily corroded by water, then the wire harness for the injection valves and the engine wire harness need to be replaced.
- Ensure correct fit of the plugs.

