



Opel Corsa B, Tigra, Astra F, Vectra B, Calibra, Omega B, Frontera, Monterey

Engine warning light illuminates

If there are complaints about these vehicles concerning the fact that the engine warning light illuminates and that fault diagnosis via the diagnostics plug is not possible, this may be caused by the installation of a different radio.

The original Opel radio is checked using the same diagnostics lead as the engine control unit. If the Opel radio is replaced by an accessory unit, pin 19 (diagnostics lead) on the connection plug of the radio is occupied differently and diagnosis of the engine control unit is no longer possible.

In the event of a complaint, the brown/white cable on pin 19 of the radio plug must be separated and insulated, or the accessory radio must be removed.

Bulletin