



## ***Opel Vivaro model years 2001 – 2003 with 1.9 DI (F9Q-762) and 1.9 DTI (F9Q-760) engine***

### **Engine speed increases when gear is shifted.**

If there are complaints with these vehicles that the engine speed increases when a gear is shifted, then a possible cause can be the clutch pedal switch. In that case, the engine electronics and the clutch pedal switch are not correctly adjusted to each other. To eliminate the fault, the clutch pedal switch and the adapter cable harness need to be replaced by a modified version. The new clutch pedal switch has a longer actuation rod.

The modified clutch pedal switches will be used from January 2003.