



## **Peugeot 206 from build year 11/2001**

### **Replacing the standard radio by an accessory device.**

Replacing the standard radio by an accessory device in these vehicles can lead to problems with the voltage supply. The voltage supply of the accessory device should not be via the ISO plug, but rather through newly laid cables for terminals 15 and 30. If the ISO plug is used, the radio could stay on for 30 minutes after the ignition has been switched off.

The reason for this is as follows:

The voltage supply (15 and 30) of the standard radio is via a relay triggered by the CAN bus. As soon as the ignition has been switched off, the CAN control unit waits for the standard radio to log-off. Since this does not happen, the complete voltage supply is switched off via the relay for safety reasons after 30 minutes.

In the accessory radio, this deletes the complete station memory and any coding that may have been programmed.