



Saab 9-3 Cabrio Model year 1998-2001

Electric folding top sticks during opening / closing.

If there are complaints with these vehicles that the electric folding top sticks during opening / closing, one possible cause is a poor ground connection. The ground connections on the hydraulic cylinders are affected. In this case, the fault codes B2015 and B2016 are stored in the fault memory.

To eliminate the fault, check the ground connection on the right-hand and left-hand hydraulic cylinder and repair if necessary. There is a repair set available from Saab for this purpose.

To reach the hydraulic cylinder, lift the rear part of the folding top. After the ground connections have been repaired, delete the fault memory.

