




Saab 9-3 convertible Model year 1998–2000

Failure of the electric folding top.

If there are complaints with these vehicles that the electric folding top is not working or stops when opening or closing, one possible cause is a defective microswitch for the folding-top lock. At the same time, fault codes B2025, B2026, B2030, B2031 may be stored in the fault memory. To eliminate the fault, the defective microswitch must be replaced. One microswitch is located on each side, on the right and left, behind the rear side trim. The rear side trim must be removed in order to replace the microswitch.

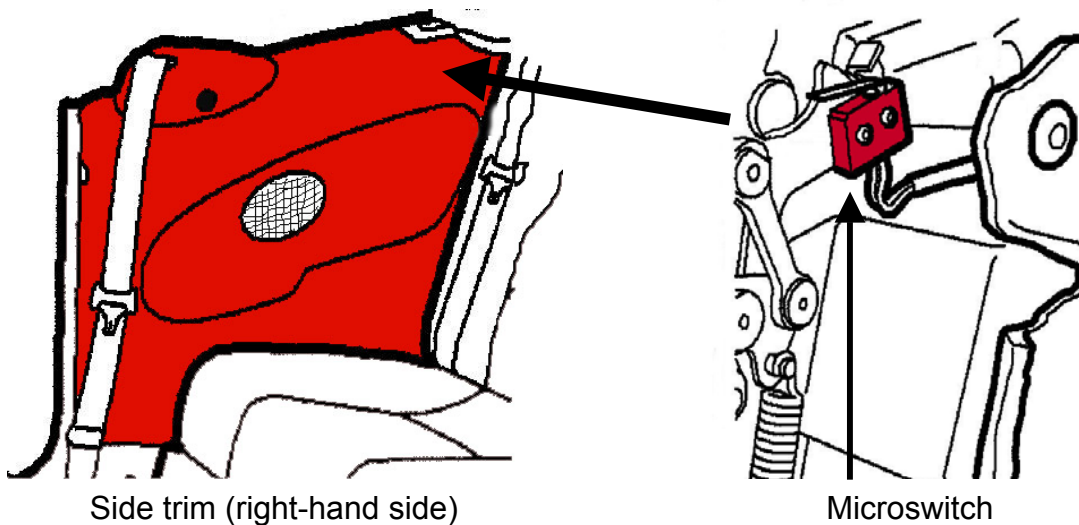

Side trim (right-hand side)

Microswitch