



Saab 9 – 3 from model year 1998

Failure of the rear windscreen wiper.

If there are complaints with these vehicles that the rear windscreen wiper is not working, one possible cause can be a loose nut on the wiper arm. If the wiper arm does not move when the rear windscreen wiper is switched on, or only moves a little, the torque of the attachment nut should be checked.

To do this, flip open the cover cap on the rear windscreen wiper. Make sure the wiper motor is off. Unscrew the attachment nut and move the wiper arm into its basic position. Apply Loctite to the thread of the attachment nut and tighten the nut using a torque of 8.5 Nm. Check the correct function of the rear windscreen wiper.